

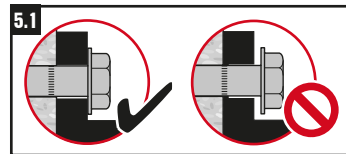
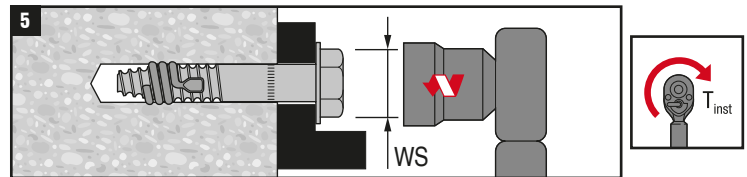
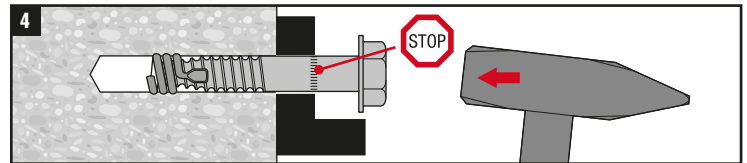
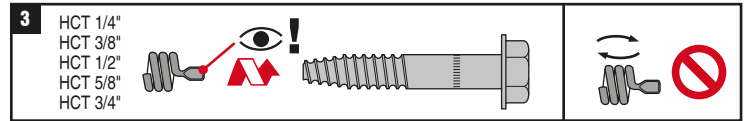
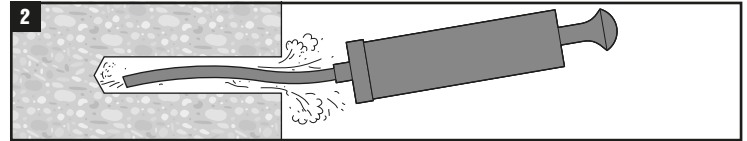







HCA	Ø d ₀ [inch]	t _{fix} [inch]	h ₁ [inch]	d _r [inch]
1/4 x 1 3/4		0 ... 5/8	1 3/4 - t _{fix}	
1/4 x 2 1/2	1/4	0 ... 1 3/8	2 1/2 - t _{fix}	5/16
1/4 x 3 1/2		0 ... 2 3/8	3 1/2 - t _{fix}	
3/8 x 2 1/4		0 ... 1/8	2 1/4 - t _{fix}	
3/8 x 3	3/8	0 ... 7/8	3 - t _{fix}	7/16
3/8 x 5		0 ... 2 7/8	5 - t _{fix}	
1/2 x 3		0 ... 3/8	3 - t _{fix}	
1/2 x 4	1/2	0 ... 1 3/8	4 - t _{fix}	9/16
1/2 x 5 1/2		0 ... 2 7/8	5 1/2 - t _{fix}	
1/2 x 7		0 ... 4 3/8	7 - t _{fix}	
5/8 x 3 1/2		0 ... 3/8	3 1/2 - t _{fix}	
5/8 x 5	5/8	0 ... 1 7/8	5 - t _{fix}	11/16
5/8 x 8		0 ... 4 7/8	8 - t _{fix}	
3/4 x 4 1/2		0 ... 1/4	4 1/2 - t _{fix}	
3/4 x 6	3/4	0 ... 1 3/4	6 - t _{fix}	13/16
3/4 x 10		0 ... 5 3/4	10 - t _{fix}	

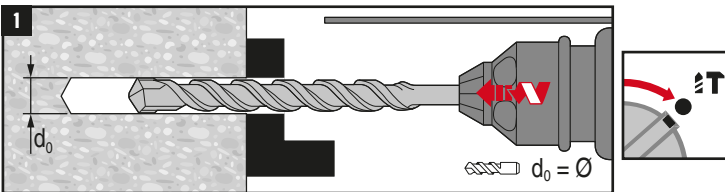

5.2 HCA [inch]	WS [inch]	T _{inst} [ft-lb]
Ø 1/4	7/16	10
Ø 3/8	9/16	40
Ø 1/2	3/4	80
Ø 5/8	15/16	130
Ø 3/4	1 1/8	180

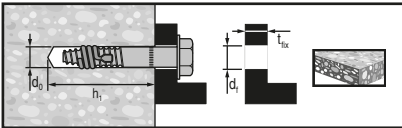

HCA	$\varnothing d_0$ [mm]	t_{fix} [mm]	h_t [mm]	d_1 [mm]
16 x 90	16	0...10	95 - t_{fix}	18
16 x 130	16	0...10	135 - t_{fix}	18

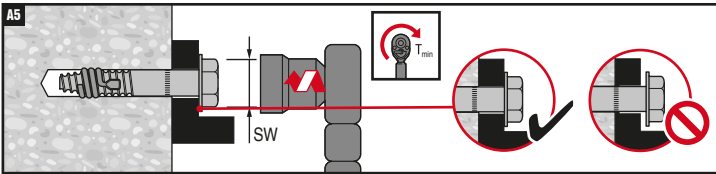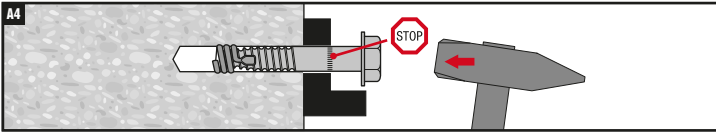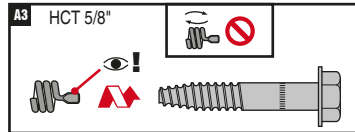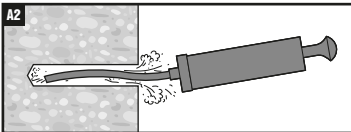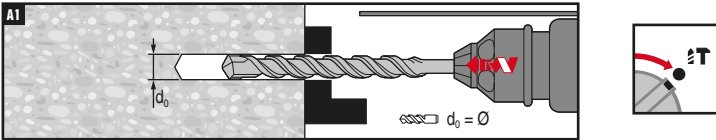

HCA [mm]	SW [mm]	t_{fix} [mm]	T_{min} [Nm]
$\varnothing 16$	24	10	180

